High Accuracy Non-Contact Measuring System LASER SCAN MICROMETER



Catalog No. E4156-544

Non-contact measuring system combines high-rate scanning (3200 scans/sec) with highly accurate measurement



Laser Scan Micrometers

High scanning rate (3200 scans/sec) and high accuracy, non-contact measuring systems. The LSM features a very high scanning rate which allows inspection of small workpieces even if they are fragile, at a high temperature, in motion or

vibrating.



FEATURES

0.005mm-diameter ultra-fine wires to 160mmdiameter cylinders can be measured: Seamless measurement range models

A rich assortment of models for diverse measuring applications. The LSM-500S can measure ultra-fine wires as thin as 0.005mm in diameter to a resolution of 0.00001mm, and the LSM-516S can measure cylindrical workpieces with a diameter as large as 160mm. The LSM-9506 bench-top model combines a display section and measurement section all in one unit.

Ultra-high scanning rate 3200 scans/sec

The incorporation of a sixteen-face polygonal mirror and a highprecision motor now makes scanning at 3200 scans per second possible. This formidable capability is ideal, for example, for taking measurements on high-speed production lines or on vibrating workpieces.

Certified accuracy over the entire measurement

The specified high accuracy over the entire measurement range is certified by the "Traceability System to the International Standard" which Mitutoyo, as a leading manufacturer of precision measurement tools and instruments, has established within its business practises.

Improved resistance to IP64-level environments

The measuring unit has been extensively developed to resist rough measurement environments. As a result, for example, it can operate at an ambient temperature of 45°C. (IP64-level resistance is not guaranteed for the display unit and the LSM-9506.)

DIN-size compact panel-mounted display unit (LSM-5200, made-to-order model)


The LSM-5200 display unit is a compact DIN size, allowing it to be mounted in a panel so as to be suitable for mounting in a rack, etc., for use on production lines.

Standard I/O output, analog output and **RS-232C** output interfaces

The LSM-5200/6200/6900 has a standard I/O and analog output interface to connect it to an operation controller or PLC used on a production line. Also, every model has a standard RS-232C interface for connection to personal computers or printers.



PRINCIPLE

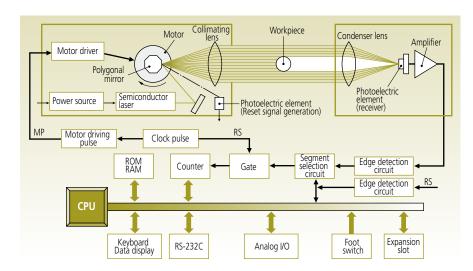

A laser beam is directed at a polygonal mirror rotating at high speed in exact synchronism with highly stable pulses from the system clock. The reflected beam is rotating clockwise as it sweeps across the input surface of a collimating lens but changes direction to be always horizontal after the lens' exit surface as it moves, or scans, downward. This horizontal beam enters the measuring space and, with no workpiece present, reaches a receiver via a condensing lens to produce an output signal. When a simple workpiece (a cylinder, for example) is put into the measuring space the beam will be interrupted for a time during its sweep and this time, as indicated by clock pulses occurring while the receiver signal is absent, is proportional to the workpiece dimension in the downward direction.

Each transition between the receiver detecting the beam and then not detecting the beam, or vice versa, is called an 'edge' and marks the start and/or end of measuring sections called 'segments', so that the differences in position of these edges define the length of each segment. The edges and segments generated by a workpiece are numbered sequentially by the instrument and are used when writing programs to extract the required dimensional data.


INDEX


| INDLA | Pages |
|---|-------|
| Applications | 4 |
| All Models of Laser Scan Micrometer | 6 |
| Measuring Unit | |
| LSM-902/6900 Ultra-High Accuracy Measuring Unit | 8 |
| LSM-500S Ultra-Fine Wire Measuring Unit | 10 |
| LSM-501S Fine Wire Measuring Unit | 12 |
| LSM-503S Standard Measuring Unit | 14 |
| LSM-506S Wide Range Measuring Unit | 16 |
| LSM-512S Ultra-Wide Range Measuring Unit | 18 |
| LSM-516S Ultra-Wide Range Measuring Unit | 20 |
| LSM-9506 Bench-top Type with Display Unit | 22 |
| Optional Accessories for Measuring Unit | |
| Calibration Gage Sets | 23 |
| Extension Signal Cables | 23 |
| Extension Relay Cables | 23 |
| Workstage | 23 |
| Wire Guiding Pulleys | 23 |
| Air-screen System | 23 |
| Adjustable Workstages | 24 |
| | |


| | Pages |
|--|-------|
| Display Unit | |
| LSM-5200 Compact (Panel-mount) Type Display Unit | 28 |
| LSM-6200 Multi-function Type Display Unit | 29 |
| LSM-5200/6200/6900/9506 Functions | 30 |
| LSM-5200/6200/6900/9506 Data I/O Specifications | 32 |
| Optional Accessories for Display Unit | |
| LSMPAK | 34 |
| BCD Interface Unit | 34 |
| Digimatic Code-out Unit | 35 |
| Dual-type Add-on Unit | 35 |
| 2nd I/O-Analog Interface Unit | 36 |
| BCD/2nd I/O-Analog Interface Cable | 37 |
| Thermal Printer | 37 |
| Footswitch | 37 |
| Glossary | 38 |
| Precautions | |
| Observe the following precautions | 39 |
| Re-assembly after removal from the base | 39 |


Applications




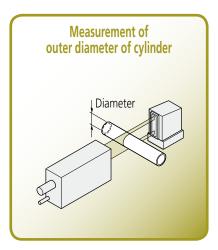


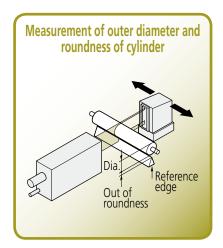


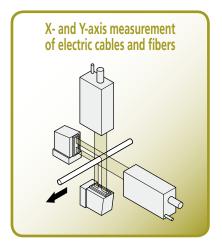


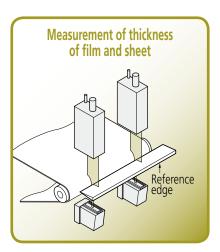

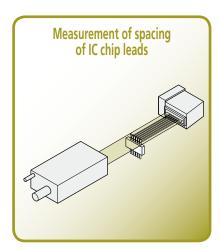


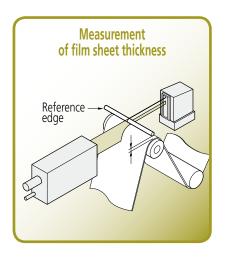


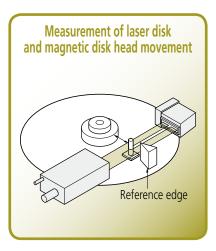


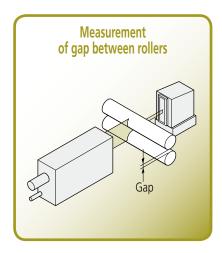



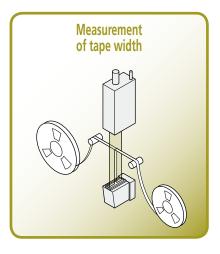

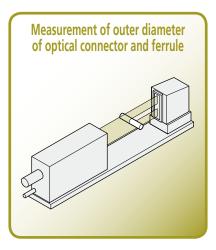

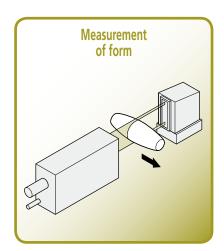

Optimal for Inspecting the Outside Diameter of Pin Gages or Plug Gages


The use of world-class laser scan micrometer LSM-902/6900 along with an adjustable workstage allows high-accuracy measurement inspection of the outside diameter of pin gages or plug gages. This LSM is also capable of data output to an external device such as a personal computer from the display unit.

(Measurement data can be stored easily in cells on EXCEL by using the Mitutoyo input tool.)

Major Specifications

Measuring range: 0.1mm to 25.0mm in diameter

 $\begin{array}{ll} \textbf{Resolution:} & 0.01 \mu m \\ \textbf{Linearity:} & \pm 0.5 \mu m \\ \textbf{Repeatability:} & \pm 0.05 \mu m \end{array}$

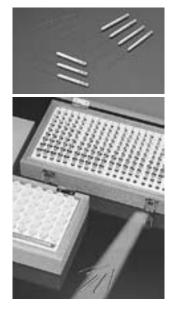



ALL MODELS OF LASER SCAN MICROMETER

MEASURING UNITS

| Measuring range | Model | Refer to |
|--|----------|----------|
| 0.005 - 2mm (.0002"08") | LSM-500S | Page 10 |
| 0.05 - 10mm (.002"4") FDA Class II | LSM-501S | Page 12 |
| 0.3 - 30mm (.012" - 1.18") | LSM-503S | Page 14 |
| 1 - 60mm (.04" - 2.36") | LSM-506S | Page 16 |
| 1 - 120mm (.04" - 4.72") | LSM-512S | Page 18 |
| 1 - 160mm (.04" - 6.30") | LSM-516S | Page 20 |



MEASURING UNIT (Factory-set package)

| Measuring range | Model | Refer to |
|------------------------------|--------------|----------|
| 0.1 - 25mm (.004" - 1.0") | LSM-902/6900 | Page 8 |

MEASURING UNIT WITH INTEGRATED DISPLAY

| Measuring range | Model | | Refer to |
|------------------------------|--|-------|----------|
| 0.5 - 60mm (.02" - 2.36") | LSM-9506 Measuring unit / integrated-display model for bench-top use only | 7.700 | Pages 22 |

DISPLAY UNITS


| Туре | Model | Refer to |
|--|----------|----------|
| Multi-function (Power Supply 100V - 240V AC) | LSM-6200 | Page 29 |
| Compact (Power Supply +24V DC) | LSM-5200 | Pages 28 |

LSM-902/6900

Ultra-High Accuracy Measuring Unit

- Suitable for pin and plug gage measurements.
- Wide measuring range of ø0.1mm to ø25mm
- Provides ultra-high accuracy with a linearity of ±0.5μm over the entire measurement range and ±(0.3+0.1△D)μm in the narrow range.
- Ultra-high repeatability of ±0.05µm



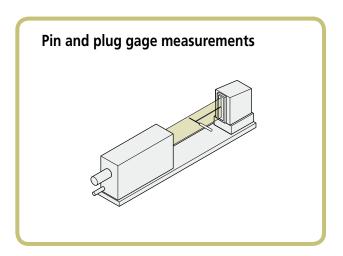

SPECIFICATIONS

| SPECIFIC | AHONS | | | | |
|---|---|--|-----------------------------|-----------------|--|
| Model | | LSM-902/6900 | | | |
| Order No. | 100/110V AC | 544-495C | 544-496C | | |
| (Order no. suffix | 120V AC | 544-495A | 544-496A | | |
| denotes the AC power cord type | 220/230V AC | 544-495D | 544-496D | | |
| equipped.) | 240V AC | 544-495E | 544-496E | | |
| | 240V AC > | 544-495F | 544-496F | | |
| <display td="" unit<=""><td>></td><td></td><td></td></display> | > | | | | |
| Acceptable st | tandard of laser | IEC (FDA: 544-495A) | IEC (FDA: 544-496A) | | |
| Measuring range | | 0.1 - 25mm (| .004" - 1.0") | | |
| Resolution (se | esolution (selectable) 0.00001 - 0.01mm (.000001"00 | | (.000001"0005") | | |
| Repeatability*1 | | ±0.05µm (±1.9µinch) | | | |
| Linearity | Entire range | ±0.5μm (: | ±0.5µm (±20µinch) | | |
| at 20°C*2 | Narrow range | ±(0.3+0.1ΔD)μm*5 | | | |
| Positional err | or*3 | ±0.5μm (: | ±20µinch) | | |
| Measuring region*4 | | 3x25mm (| .12"x.98") | | |
| Scanning rate | 9 | 800 s | cans/s | | |
| Laser waveler | ngth | 650nm, Visible*6 | | | |
| Laser scannin | ig speed | 56m/s (2200"/s) | | 56m/s (2200"/s) | |
| Operating ter | | 0°C - 40°C | | | |
| Operating hu | ımidity | 35 - 85% RH (with no condensation) | | | |
| Mass | - | Measuring unit: 6.0kg (13.2lbs.), Signal cable: 0.5kg (1.1lbs.) | | | |

<Measuring unit>

| mm inch/mm | |
|---|--|
| | pe (for measurement) & tube (sub display) |
| Seg.1 to Seg.7 (Seg.1 - Seg.3 for transparent objects) | |
| 1 to 255 edges | can be detected |
| Arithmetical average: per 1 to 2048, moving average: per 32 to 2048 | |
| Nominal value ±tolerance setting, upper & lower limits setting, multi-limit setting | |
| Waiting, single measurement, continuous measurement | |
| Maximum measurement (MAX), minimum measurement (MIN), mean, range (MAX-MIN), standard deviation (σ) | |
| 100 - 240V AC ±10%, 50/60Hz, 40VA | |
| Via RS-232C and I/O-Analog interfaces | |
| (See page 16 and 17.) | |
| 0°C - 40°C | |
| 35 - 85% RH (with no condensation) | |
| 5kg (11lbs.) | |
| | 16-digit fluorescent tut 11-digit fluorescen Seg.1 to Seg.7 (Seg.1 obje 1 to 255 edges Arithmetical average: average: per Nominal value ±toleranc limits setting, m Waiting, single meas measu Maximum measurem measurement (MIN), m standard di 100 - 240V AC ±10 Via RS-232C and M (See page 0°C - 35 - 85% RH (with |

- > For Australia *1: Determined by the value for $\pm 2\sigma$ at the measurement of ø25mm workpiece with 1.28sec.
- *1: Determined by the value for £2 σ at the measurement of ø25mm workpiece with 1.28sec. interval (1024-time avarage).

 *2: At the center of the measuring region.


 *3: An error due to workpiece shift either in the optical axis direction or in the scanning direction.

 *4: The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".

 *5: Δ D=Difference in diameter between the master gage and workpiece in mm.

 *6: FDA Class I/IEC Class 2 semiconductor laser for scanning (Maximum power: 1.5mW)




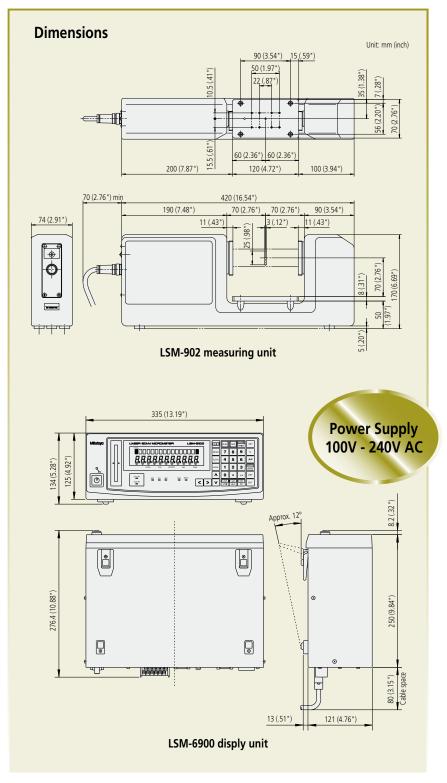

OPTIONAL ACCESSORIES





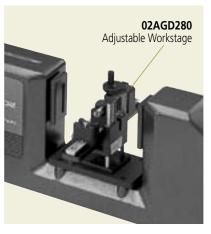


LSM-500S


Ultra-Fine Wire Measuring Unit

- Permits measurements starting from ø5µm
- Provides ultra-high accuracy with a linearity of ±0.3μm over the entire measurement range (5μm to 2mm).
- Ultra-high repeatability of ±0.03µm




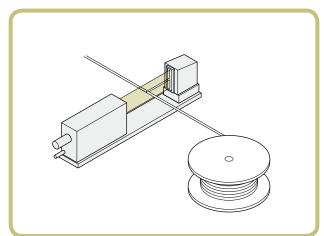


| Model | LSM-500S | |
|------------------------------|------------------------------------|-------------------------------------|
| Order No. | 544-531 544-532 | |
| Acceptable standard of laser | JIS | IEC, FDA |
| Measuring range*1 | 0.005 - 2mm (| .0002"08") |
| Resolution (selectable) | 0.00001 - 0.01mm | ("000001"0005") |
| Repeatability*2 | ±0.03μm (| ±1.1µinch) |
| Linearity at 20°C*3 | ±0.3μm (: | ±12µinch) |
| Positional error*4 | ±0.4µm (±16µinch) | |
| Measuring region*5 | 1x2mm (.04"x.08") | |
| Scanning rate | 3200 scans/s | |
| Laser wavelength | 650nm, Visible*6 | |
| Laser scanning speed | 76m/s (3000"/s) | |
| Operating temperature | 0°C - 40°C | |
| Operating humidity | 35 - 85% RH (with no condensation) | |
| Water/Dust protection grade | Conforming to IP64*7 | |
| Mass | | 1.0kg (2.2lbs.), 0.5kg (1.1lbs.) |

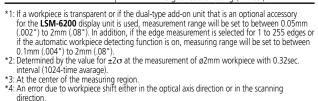


- *5: The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".
- *6: FDA Class I/IEC Class 2 semiconductor laser for scanning (Maximum power: 1.3mW)
 *7: The protection level provided for the interior. If the workpiece or glass of the measuring unit window is soiled by water or dust, the unit may malfunction.

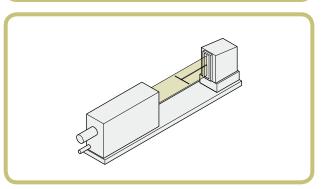



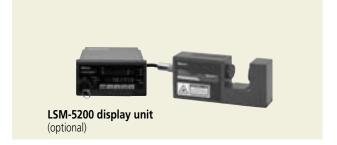



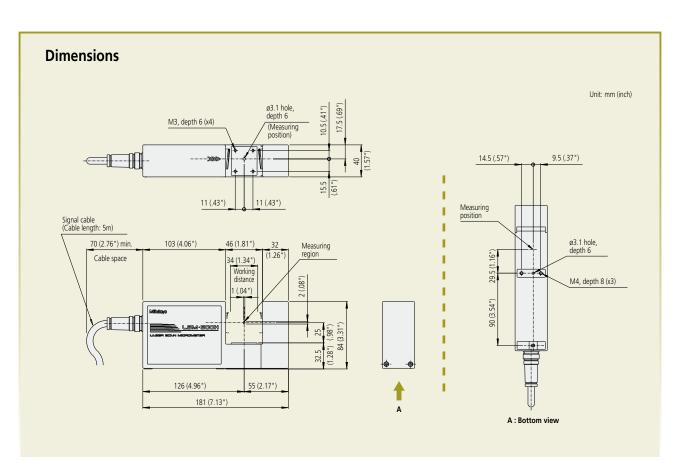

OPTIONAL ACCESSORIES



957608 02AGN780A 02AGN780B 02AGN780C Air cleaner for air-screen covers Extension signal cable 5m Extension signal cable 10m Extension signal cable 15m






LSM-501S

Fine Wire Measuring Unit


- Provides ultra-high accuracy with a linearity of ±0.5µm over the entire measurement range (0.05mm to 10mm) and ±(0.3+0.1∆D)µm in the narrow range.


 • Ultra-high repeatability of ±0.04µm



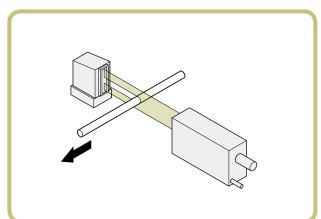

| Model | | LSM-501S | | |
|---------------|-------------------|--|------------------|--|
| | | | | |
| Order No. | | 544-533 | 544-534 | |
| Acceptable | standard of laser | JIS IEC, FDA | | |
| Measuring r | ange | 0.05 - 10mm | (.002"4") | |
| Resolution (| selectable) | 0.00001 - 0.01mm (| (.000001"0005") | |
| Repeatabilit | y*1 | ±0.04µm (: | ±1.5µinch) | |
| Linearity | Entire range | ±0.5µm (: | ±20µinch) | |
| at 20°C*2 | Narrow range | ±(0.3+0. | 1 Δ D)μm | |
| Positional er | rror*3 | ±0.5µm (: | ±20μinch) | |
| Measuring r | egion*4 | 2 x 10mm at ø0.05 - 0.1mm (.08" x .4" at ø.002"004") 4 x 10mm at ø0.1 - 10mm (.16" x .4" at ø.004"4") | | |
| Scanning ra | te | 3200 s | scans/s | |
| Laser wavele | ength | 650nm, | Visible*5 | |
| Laser scanni | ing speed | 113m/s (| 4450"/s) | |
| Operating to | emperature | 0°C - 40°C | | |
| Operating h | umidity | 35 - 85% RH (with | no condensation) | |
| Water/Dust | protection grade | Conforming to IP64*6 | | |
| Mass | | Emission unit: 0.7kg (1.54lbs.), Reception unit: 0.4kg (.88lbs.), Base: 0.3kg (.66lbs.), Signal cable: 0.5kg (1.1lbs.) | | |

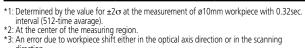

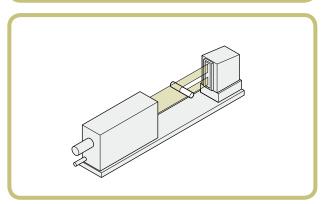








^{*3:} An error due to workpiece shift educating the operations and all acceptances of direction.

*4: The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".

*5: FDA Class I/IEC Class 2 semiconductor laser for scanning (Maximum power: 1.3mW)

*6: The protection level provided for the interior. If the workpiece or glass of the measuring unit window is soiled by water or dust, the unit may malfunction.

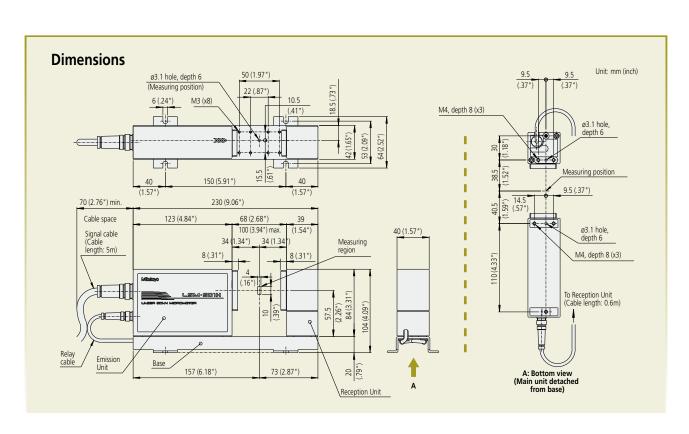

OPTIONAL ACCESSORIES












02AGD440Center support*02AGD450Adjustable V-block*957608Air cleaner for air-screen cover02AGC150AExtension relay cable 1m02AGN780AExtension signal cable 5m02AGN780BExtension signal cable 10m02AGN780CExtension signal cable 15m


*Use with an adjustable workstage.


LSM-503S

Standard Measuring Unit


- General-purpose type with a measurement range of 0.3mm to 30mm.
- Provides high accuracy with a linearity of ±1.0μm over the entire measurement range and ±(0.6+0.1ΔD)μm in the narrow range.
- Excellent repeatability of ±0.1µm

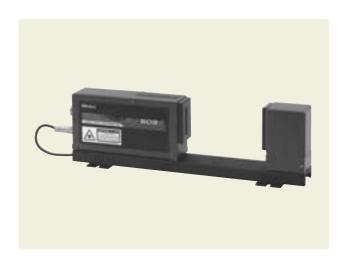

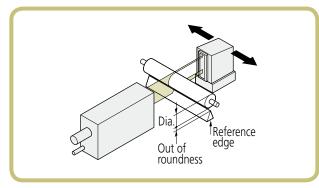

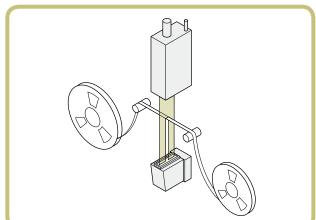


| Model | | LSM-503S | | | |
|---|--|---|--------------------|--------------|--|
| Order No. | | 544-535 | 544-536 | | |
| Acceptable | standard of laser | JIS | IEC, FDA | | |
| Measuring | range | 0.3 - 30mm (. | 012" - 1.18") | | |
| Resolution | (selectable) | 0.00002 - 0.1mm | (.000001"005") | | |
| Repeatabilit | ty*1 | ±0.1µm (± | ±3.9µinch) | | |
| Linearity | Entire range | ±1.0μm (: | ±40µinch) | | |
| at 20°C*2 | Narrow range | ±(0.6+0. | 1 ∆ D)µm | | |
| Positional e | rror*3 | ±1.5µm (±60µinch) | | | |
| Measuring | region*4 | 10 x 30mm (.4" x 1.18") | | | |
| Scanning ra | nte | 3200 scans/s | | 3200 scans/s | |
| Laser wavelength | | 650nm, | Visible*5 | | |
| Laser scanning speed | | 226m/s (| (8900"/s) | | |
| Operating t | emperature | 0°C - | 40°C | | |
| Operating h | Operating humidity 35 - 85% RH (with no condensation | | n no condensation) | | |
| Water/Dust protection grade Conforming to IP64* | | g to IP64*6 | | | |
| Mass | | Emission unit: 1.1kg (2.42lbs.), Reception unit: 0.6kg (1.32lbs.), Base: 0.5kg (1.1lbs.), Signal cable: 0.5kg (1.1lbs.) | | | |

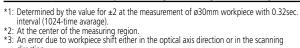

^{*5:} FDA Class I/IEC Class 2 semiconductor laser for scanning (Maximum power: 1.3mW)
*6: The protection level provided for the interior. If the workpiece or glass of the measuring unit window is soiled by water or dust, the unit may malfunction.




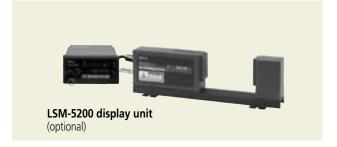




direction.

*4: The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".

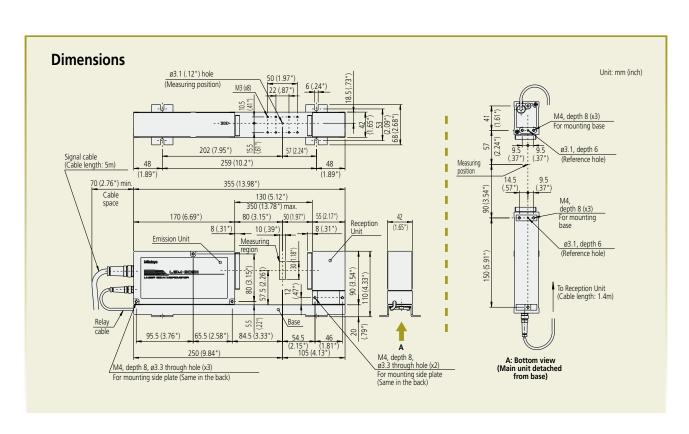


OPTIONAL ACCESSORIES



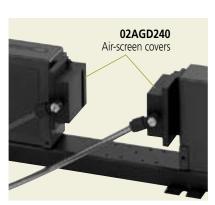



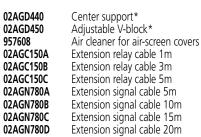







LSM-506S


Wide Range Measuring Unit


- General-purpose type with a measurement range of 1mm to 60mm.
 Provides high accuracy with a linearity of ±3µm over the entire measurement range and ±(1.5+0.5△D)µm in the narrow range.
 Excellent repeatability of ±0.36µm

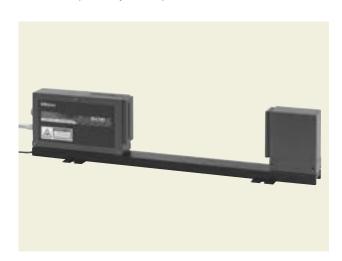

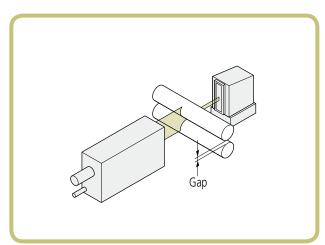


| Model | | LSM-506S | |
|-------------------------------------|----------------------------|--|-----------------|
| Order No. | | 544-537 | 544-538 |
| Acceptable | standard of laser | JIS | IEC, FDA |
| Measuring | range | 1 - 60mm (.i | 04" - 2.36") |
| Resolution | (selectable) | 0.00005 - 0.1mm | (.000002"005") |
| Repeatabili | ty*1 | ±0.36µm (| ±14µinch) |
| Linearity | Entire range | ±3µm (±1 | I20μinch) |
| at 20°C*2 | Narrow range | ±(1.5+0. | 5 Δ D)μm |
| Positional e | error*3 | ±4µm (±160µinch) | |
| Measuring region*4 | | 20 x 60mm (.8" x 2.36") | |
| Scanning ra | ate | 3200 scans/s | |
| Laser wave | ser wavelength 650nm, Visi | | Visible*5 |
| Laser scanning speed | | 452m/s (1 | 17800"/s) |
| Operating : | temperature | 0°C - 40°C | |
| Operating humidity 35 - 85% RH (wit | | n no condensation) | |
| Water/Dust | t protection grade | Conforming to IP64*6 | |
| Mass | | Emission unit: 1.4kg (3.08lbs.), Reception unit: 0.8kg (1.76lbs.), Base: 0.8kg (1.76lbs.), Signal cable: 0.5kg (1.1lbs.) | |

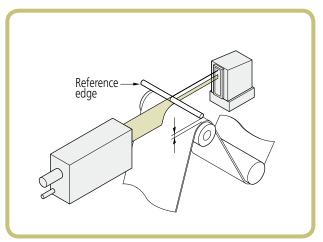

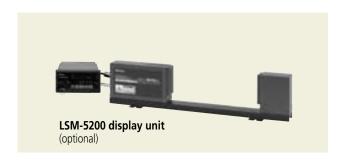





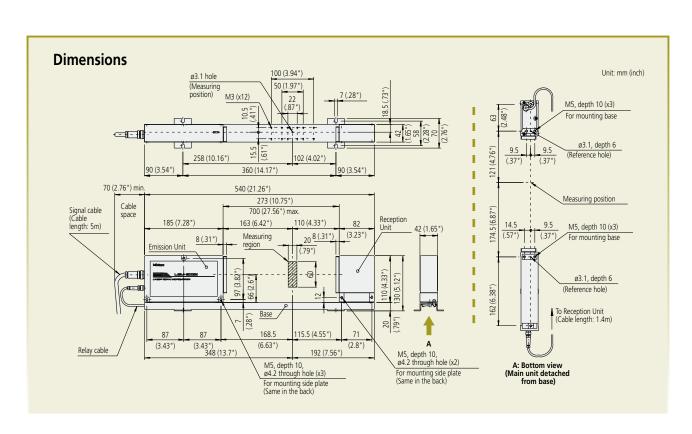

OPTIONAL ACCESSORIES








02AGD580 Center support* 02AGD590 Adjustable V-block* 02AGD250 Air-screen cover 957608 Air cleaner for air-screen covers 02AGC150A Extension relay cable 1m Extension relay cable 3m Extension relay cable 5m 02AGC150B 02AGC150C 02AGN780A Extension signal cable 5m 02AGN780B Extension signal cable 10m 02AGN780C Extension signal cable 15m 02AGN780D Extension signal cable 20m


*Use with an adjustable workstage.

LSM-512S


Ultra-Wide Range Measuring Unit


- General-purpose type with a wide measurement range of 1mm to 120mm.
- Provides high accuracy with a linearity of ±6µm over the entire measurement range and ±(4.0+0.5△D)µm in the narrow range.
- Excellent repeatability of ±0.8µm

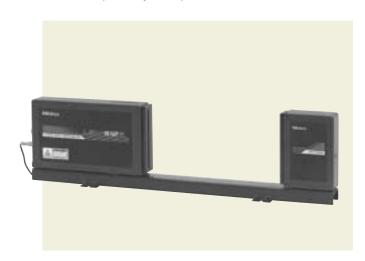


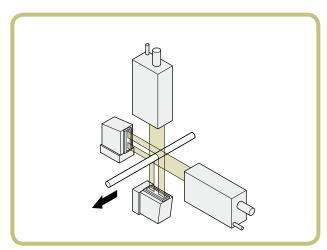


| Model | | LSM-512S | |
|-----------------------------|-------------------|---|-----------------|
| Order No. | | 544-539 | 544-540 |
| Acceptable : | standard of laser | JIS | IEC, FDA |
| Measuring r | ange | 1 - 120mm (| 04" - 4.72") |
| Resolution (| selectable) | 0.0001 - 0.1mm (.000005"005") | |
| Repeatability | y*1 | ±0.8µm (: | ±32µinch) |
| Linearity | Entire range | ±6µm (±2 | 240µinch) |
| at 20°C*2 | Narrow range | ±(4.0+0. | 5 Δ D)μm |
| Positional er | rror*3 | ±8µm (±320µinch) | |
| Measuring region*4 | | 30 x 120mm at ø1 - 120mm (1.2" x 4.72" at ø.04" - 4.72") | |
| Scanning rate | | 3200 scans/s | |
| Laser wavele | ength | 650nm, Visible*5 | |
| Laser scanni | ing speed | 904m/s (35590 "/s) | |
| Operating to | emperature | 0°C - 40°C | |
| Operating humidity | | 35 - 85% RH (with no condensation) | |
| Water/Dust protection grade | | Conforming to IP64*6 | |
| Mass | | Emission unit: 3.0kg (6.6lbs.), Reception unit: 1.2kg (2.64lbs.), Base: 1.8kg (3.96lbs.), Signal cable: 0.5kg (1.1lbs.) | |

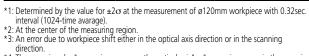

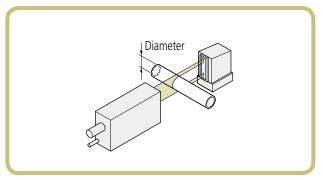

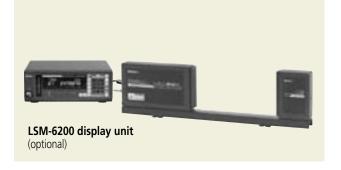


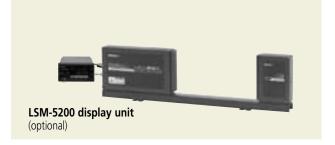



^{*4:} The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".

^{*5:} FDA Class I/I/EC Class 2 semiconductor laser for scanning (Maximum power: 1.3mW)
*6: The protection level provided for the interior. If the workpiece or glass of the measuring unit window is soiled by water or dust, the unit may malfunction.

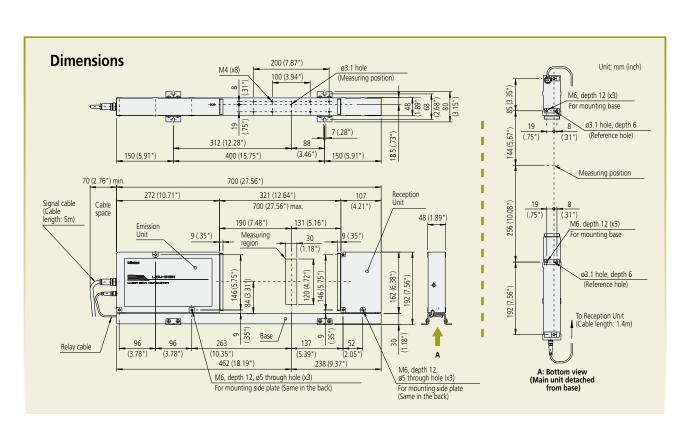

OPTIONAL ACCESSORIES






957608Air cleaner for air-screen covers02AGC150AExtension relay cable 1m02AGC150BExtension relay cable 3m02AGC150CExtension relay cable 5m02AGN780AExtension signal cable 5m02AGN780BExtension signal cable 10m02AGN780CExtension signal cable 15m02AGN780DExtension signal cable 20m

LSM-516S


Ultra-Wide Range Measuring Unit


- General-purpose type with a wide measurement range of 1mm to 160mm.
 Provides high accuracy with a linearity of ±7µm over the entire measurement range and ±(4.0+2.0∆D)µm in the narrow range.
- ●Excellent repeatability of ±1.4µm




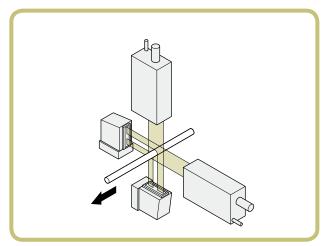

| Model | | LSM-516S | |
|-----------------------------|-------------------|---|-----------------|
| Order No. | | 544-541 | 544-542 |
| Acceptable | standard of laser | JIS | IEC, FDA |
| Measuring | range | 1 - 160mm (| 04" - 6.30") |
| Resolution | (selectable) | 0.0001 - 0.1mm (.000005"005") | |
| Repeatabili | ty*1 | ±1.4μm (: | ±55µinch) |
| Linearity | Entire range | ±7μm (±2 | ?76µinch) |
| at 20°C*2 | Narrow range | ±(4.0+2. | 0 Δ D)μm |
| Positional e | error*3 | ±8µm (±320µinch) | |
| Measuring region*4 | | 40 x 160mm at ø1 - 160mm (1.57" x 6.30" at ø.04" - 6.30") | |
| Scanning ra | ate | 3200 scans/s | |
| Laser wave | length | 650nm, Visible*5 | |
| Laser scann | ning speed | 603m/s (23740 "/s) | |
| Operating t | temperature | 0°C - 40°C | |
| Operating humidity | | 35 - 85% RH (with no condensation) | |
| Water/Dust protection grade | | Conforming to IP64*6 | |
| Mass | | Emission unit: 3.0kg (6.6lbs.), Reception unit: 1.2kg (2.64lbs.), Base: 1.8kg (3.96lbs.), Signal cable: 0.5kg (1.1lbs.) | |

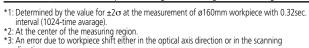

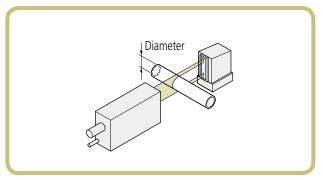


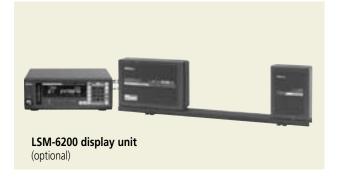





^{4:} The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".
5: FDA Class IMEC Class 2 semiconductor laser for scanning (Maximum power: 1.3mW)
6: The protection level provided for the interior. If the workpiece or glass of the measuring unit window is soiled by water or dust, the unit may malfunction.

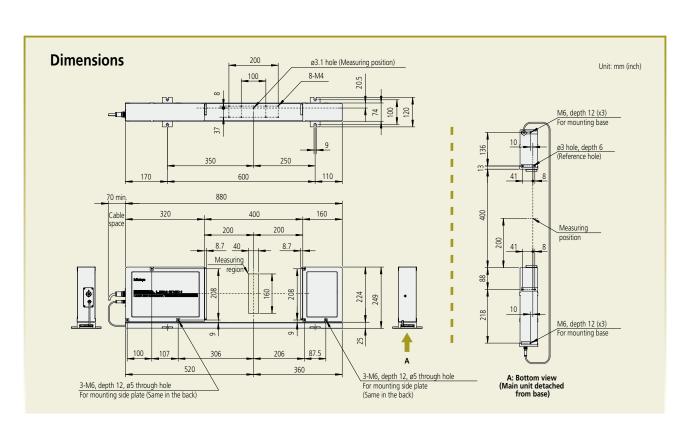

OPTIONAL ACCESSORIES



 02AGC150A
 Exten

 02AGC150B
 Exten

 02AGC150C
 Exten

 02AGN780A
 Exten

 02AGN780B
 Exten

 02AGN780C
 Exten


 02AGN780D
 Exten

Extension relay cable 1m Extension relay cable 3m Extension relay cable 5m Extension signal cable 5m Extension signal cable 10m Extension signal cable 15m Extension signal cable 20m



LSM-9506

Bench-top Type with Display Unit

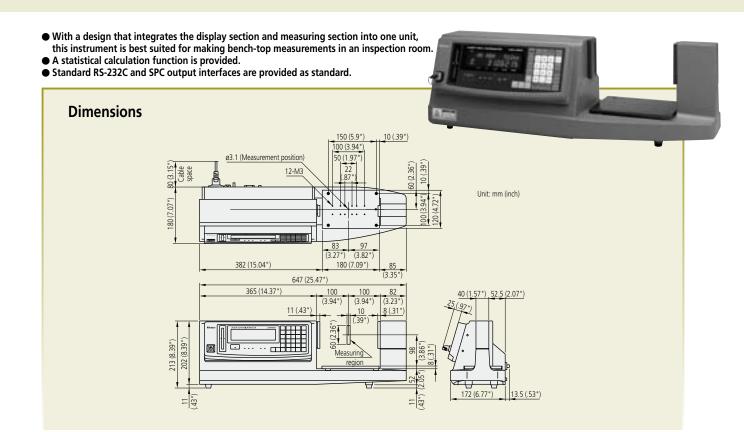


SPECIFICATIONS

| Model | | LSM-9506 | |
|-----------------------------------|-------------|--|------------------------------|
| Order No. | 100/110V AC | 544-115C | 544-116C |
| (Order no. suffix | 120V AC | 544-115A | 544-116A |
| denotes the AC power cord type | 220/230V AC | 544-115D | 544-116D |
| equipped.) | 240V AC | 544-115E | 544-116E |
| | 240V AC > | 544-115F | 544-116F |
| Туре | | mm | inch/mm |
| Measuring rang | je | 0.5 - 60mm | .02" - 2.36"/0.5 - 60mm |
| Resolution (sele | ctable) | 0.00005 - 0.1mm | .000002"005"/0.00005 - 0.1mm |
| Repeatability*1 | | ±0.6µm (±24µinch) | |
| Linearity at 20°C*2 | | ±2.5μm (±100μinch) | |
| Positional error*3 | | In the optical axis direction: ±2.5µm (±100µinch) In the scanning direction: ±(2.0+L/10µm) (±(.00008+L/10000)") | |
| Measuring region*4 | | 10 x 60mm (.4" x 2.36") | |
| Scanning rate | | 1600 scans/s | |
| Laser waveleng | th | 650nm, Visible*5 | |
| Laser scanning | speed | 226m/s (8900"/s) | |
| Power supply | | 100 - 240V AC ±10%, 50/60Hz, 40VA | |
| Data output | | Via RS-232C interface, SPC (Digimatic) output port | |
| Functions | | (See page 30.) | |
| Operating temperature | | 0°C - 45°C | |
| Operating humidity | | 35 - 85% RH (with no condensation) | |
| Mass | | 13kg (28.6lbs.) | |

Mitutoyo

OPTIONAL ACCESSORIES

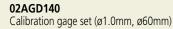



02AGD680 Adjustable Workstage 02AGD580 Center support* Adjustable V-block* 02AGD590 936937 SPC output cable (1m) 937179T Footswitch

*Use with an adjustable workstage.

For Australia

- > For Australia
 1: Determined by the value for ±2σ at the measurement interval of 0.32 sec.
 2: At the center of the measuring region.
 3: An error due to workpiece shift either in the optical axis direction or in the scanning direction. L= Distance between the center of workpiece and the center of optical axis (in pmg. rinches).
- the center of workpiece and the center of optical axis (in mm or inches).

 *4: The area given by "measuring range on the optical axis" x "measuring range in the scanning direction".

 *5: FDA Class II (544-115A, 544-116A)

Optional Accessories

Calibration Gage Sets

•The calibration gage sets are made up of precision disks, cylinders or wires used for calibrating Laser Scan Micrometers. Each gauge that may be measured in alternate positions is marked at the position where the calibration measurement was made.



| | | 1 - | |
|-----------|-------------|---|--|
| Order No. | Application | Components | |
| 02AGD110 | LSM-500S | ø0.1mm gage (958200) ø2mm gage (958202) | Gage stand (02AGD111) Set case (958203) |
| 02AGD120 | LSM-501S | ø0.1mm gage (958200) ø10mm gage (229317) | Gage stand (02AGD121) Set case (958203) |
| 02AGD180 | LSM-902 | ø1mm gage (02AGD920) ø25mm gage (02AGD963) | |
| 02AGD130 | LSM-503S | ø1mm gage (02AGD920) ø30mm gage (02AGD961) | Gage stand (02AGD131) Set case (02AGD980) |
| 02AGD140 | LSM-506S | ø1mm gage (02AGD920) ø60mm gage (02AGD962) | Gage stand (02AGD141) Set case (02AGD980) |
| 02AGD150 | LSM-512S | ø20mm gage (229730) ø120mm gage (234072) | Gage stand (02AGD151) Set case (02AGD990) |
| 02AGM300 | LSM-516S | ø20mm gage (229730) ø160mm gage (02AGM303) | Gage stand (02AGM320) Set case (02AGM310) |
| 02AGD170 | LSM-9506 | ø1mm gage (02AGD920) ø60mm gage (02AGD962) | Gage stand (02AGD171) Set case (02AGD970) |


*Not available for LSM-902

Extension Signal Cables

•Used to extend the supplied signal cable if the measuring unit and display unit need to be placed further apart from one another.

Extension Relay Cables*

•Used to extend the supplied relay cable if the emission unit and reception unit need to be placed further apart from one another.

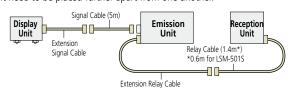

Extension signal cables

| Order No. Cable length | |
|------------------------|-----|
| 02AGN780A | 5m |
| 02AGN780B | 10m |
| 02AGN780C | 15m |
| 02AGN780D | 20m |

Extension relay cables Order No. 02AGC150A 1m 02AGC150B 3m

5m

Note 1: The maximum length of the **LSM-500S/501S** signal cable is 20m, and that of the relay cable is 2m. The maximum length of the signal and relay cables of models other than those mentioned above should be 30m or less and 5m or less, respectively.

02AGC150C

Note 2: The total length of signal and relay cables should not be more than 32m.

Workstage

•Aids shaft measurement by providing a V-block mounting and an up/down adjustment mechanism.


| Order No. | Application | |
|-----------|---------------------------------|--|
| 02AGD270 | LSM-501S LSM-503S LSM-902 | |





Wire Guiding Pulleys

•This jig is for guiding thin filaments, such as fine magnet wire or optical fiber, so that a stable measurement of the outside diameter can be made.

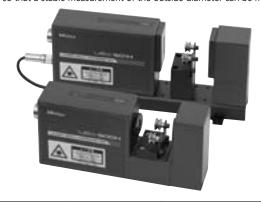

| Order No. | Application | Maximum measuring dia. |
|-----------|-------------|------------------------|
| 02AGD200 | LSM-500S | 1.6mm (.063") |
| 02AGD210 | LSM-501S | 2mm (.079") |

Note: Use the calibration gage set (02AGD110) for both types of wire guiding pulley.


Air-Screen System

•If using your LSMs in a smoky or dusty environment, an air-screen system consisting of two covers per unit and a central air cleaner/regulator can be used to help prevent the emission/reception windows from being soiled.

Air cleaner/regulator: 957608

Air-screen covers

| Order No. | Application | |
|-----------|-------------|---------|
| 02AGD220 | LSM-500S | 6 pcs.* |
| 02AGD230 | LSM-501S | 6 pcs.* |
| 02AGD240 | LSM-503S | 3 pcs.* |
| 02AGD250 | LSM-506S | 1 pc.* |
| 02AGD260 | LSM-512S | 1 pc.* |
| | | |

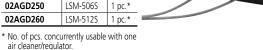


Optional Accessories for Laser Scan Micrometer

Adjustable Workstages


- Aids in measuring workpiece diameter by means of up/down and right/left slide adjustments.
- Optimum for quality control of precision shafts, rollers, pin gages, etc.

For LSM-902/6900

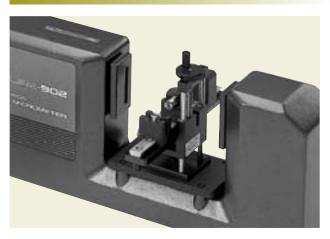

SPECIFICATIONS

| Order No. | 02AGD280 |
|-----------------------|---|
| Application | LSM-902 |
| Horizontal adjustment | 130mm (5.12") |
| Vertical adjustment | 47mm (18.50") |
| Maximum table loading | 0.5kg (1.1lbs.) |
| Mass | 0.8kg (1.8lbs.) |
| Standard accessories | ●V-block (02AGD420) x 2pcs. ●Workpiece stop (02AGD430) |

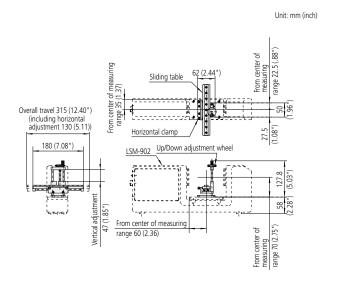


For LSM-501S




SPECIFICATIONS

| Order No. | 02AGD400 | |
|-----------------------|--|--|
| Application | LSM-501S | |
| Horizontal adjustment | 130mm (5.12") | |
| Vertical adjustment | 32mm (1.26") | |
| Maximum table loading | 0.5kg (1.1lbs.) | |
| Mass | 1.0kg (2.2lbs.) | |
| Standard accessories | V-block (02AGD420) x 2pcs. Workpiece stop (02AGD430) | |

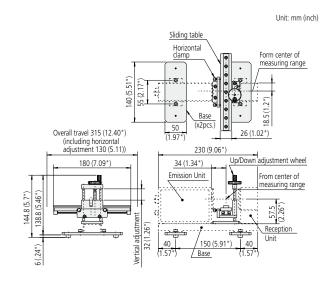


Mitutoyo

For LSM-503S

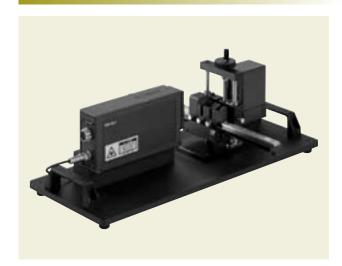

SPECIFICATIONS


| Order No. | 02AGD490 |
|-----------------------|---|
| Application | LSM-503S |
| Horizontal adjustment | 200mm (7.87") |
| Vertical adjustment | 35mm (1.38") |
| Maximum table loading | 2.0kg (4.4lbs.) |
| Mass | 4.9kg (10.78lbs.) |
| Standard accessories | •V-block (02AGD420) x 2pcs. •Workpiece stop (02AGD430) |

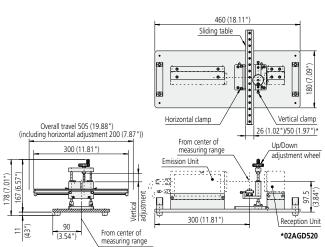

Unit: mm (inch)

Standard Accessories


V-blocks

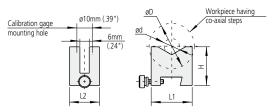

Unit: mm (inch)

| Order No. | 02AGD420 |
|------------------------------|---------------------------------|
| øD max. | 30 (1.18")* |
| ød max. | 30 (1.18")* |
| D - d max. | 25 (.98")** |
| Н | 25.5 (1") |
| L1 | 27 (1.06") |
| L2 | 20 (.79") |
| Mass | 0.03kg |
| Calibration gages to be used | • ø0.1mm • ø1mm • ø10mm • ø30mm |

Workpiece stop

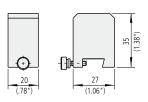


| Order No. | 02AGD430 |
|-----------|----------|
| Mass | 0.05kg |

Optional Accessories for Laser Scan Micrometer

Adjustable Workstages


- Aids in measuring workpiece diameter by means of up/down and right/left slide adjustments.
- Optimum for quality control of precision shafts, rollers, pin gages, etc.

For LSM-506S

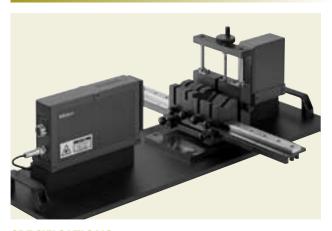

SPECIFICATIONS


| Order No. | 02AGD520 |
|-----------------------|---|
| Application | LSM-506S |
| Horizontal adjustment | 300mm (11.81") |
| Vertical adjustment | 45mm (1.77") |
| Maximum table loading | 5.0kg (11lbs.) |
| Mass | 9.7kg (21.34lbs.) |
| Standard accessories | •V-block (02AGD550) x 2pcs. •V-block (02AGD560) •V-block (02AGD570) |

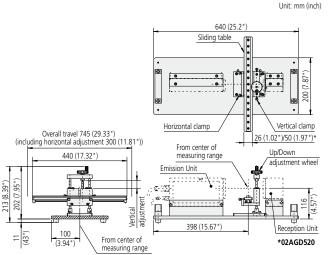

For LSM-9506

Unit: mm (inch)


| Order No. | 02AGD370 | 02AGD680 |
|-----------------------|--|-------------------|
| Application | LSM-9506 | |
| Horizontal adjustment | 200mm (7.87") | 300mm (11.81") |
| Vertical adjustment | 45mm (1.77") | |
| Maximum table loading | 2.0kg (4.4lbs.) | 5.0kg (11lbs.) |
| Mass | 3.8kg (8.4lbs.) | 4.8kg (10.56lbs.) |
| Standard accessories | •V-block (02AGD550) x 2pcs. •V-block (02AGD560) •V-block (02AGD570) | |

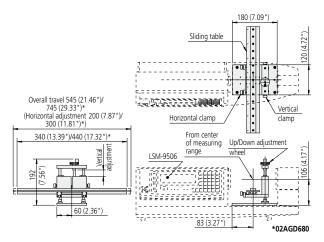



Standard Accessories

V-blocks

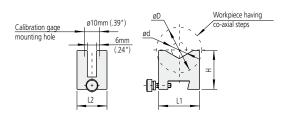


| | | | Unit: mm (incn) |
|------------------------------------|--------------------|-------------------------------|------------------------------|
| Order No. | 02AGD550 | 02AGD560 | 02AGD570 |
| øD max. | 60 (2.36") | 60 (2.36") | 60 (2.36") |
| ød max. | 60 (2.36") | 30 (1.18") | 30 (1.18") |
| D - d max. | 30 (1.18") | 50 (1.97") | 50 (1.97") |
| Н | 39 (1.54") | 45 (1.77") | 45 (1.77") |
| L1 | 50 (1.97") | 50 (1.97") | 50 (1.97") |
| L2 | 30 (1.18") | 30 (1.18") | 30 (1.18") |
| Mass | 0.12kg | 0.15kg | 0.15kg |
| Calibration gages to be used | • ø10mm • ø30mm | • ø10mm • ø30mm • ø60mm | • ø1mm • ø10mm • ø30mm |

Optional Accessories

Adjustable V-blocks

•Optional accessories for adjustable workstages.

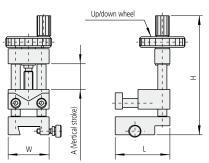


Unit: mm (inch)

| Order No. | 02AGD450 | 02AGD590 |
|-----------|-------------|---------------|
| Н | 78.8 (3.1") | 105.8 (4.17") |
| L | 36 (1.42") | 40 (1.57") |
| W | 27 (1.06") | 50 (1.97") |

Center Supports

• Optional accessories for adjustable workstages.

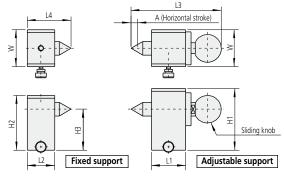

| Unit: | mm | (inch |
|-------|----|-------|

| | | Offic. Hilli (HICH) |
|-----------|------------|---------------------|
| Order No. | 02AGD440 | 02AGD580 |
| H1 | 45 (1.77") | 65 (2.56") |
| H2 | 40 (1.57") | 60 (2.36") |
| Н3 | 30 (1.18") | 45 (1.77") |
| L1 | 25 (.98") | 50 (1.97") |

| | | Unit: mm (inch) |
|-----------|------------|-----------------|
| Order No. | 02AGD440 | 02AGD580 |
| L2 | 20 (.79") | 40 (1.57") |
| L3 | 66 (2.60") | 106.5 (4.19") |
| L4 | 32 (1.26") | 55 (2.17") |
| W | 27 (1.06") | 50 (1.97") |

SPECIFICATIONS

| Order No. | 02AGD450 | 02AGD590 |
|----------------------------|--|--|
| Application | Adjustable workstage for LSM-501S (02AGD400), Adjustable workstage for LSM-902 (02AGD280), Adjustable workstage for LSM-503S (02AGD490) | Adjustable workstage for LSM-506S (02AGD520), Adjustable workstage for LSM-9506 (02AGD680) |
| Vertical adjustment (A) | 20mm (.79") | 35mm (1.38") |
| Maximum workpiece diameter | 30mm (1.18") | 60mm (2.36") |
| Mass | 0.1kg | 0.2kg |


| Order No. | 02AGD440 | 02AGD580 |
|-----------------------------|--|--|
| Application | Adjustable workstage for LSM-501S (02AGD400), Adjustable workstage for LSM-902 (02AGD280), Adjustable workstage for LSM-503S (02AGD490) | Adjustable workstage for LSM-506S (02AGD520), Adjustable workstage for LSM-9506 (02AGD680) |
| Point angle | 60° | 60° |
| Maximum workpiece length | 110mm (4.33") on 02AGD400/02AGD280 230mm (9.06") on 02AGD490 | 315mm (12.4") on 02AGD520 on 02AGD680 |
| Horizontal adjustment (A) | 5mm (.2") or more | 10mm (.39") or more |
| Center point clamping force | 1.1kgf | 3.2kgf |
| Mass | 0.18kg (.4lbs.) | 0.85kg (1.87lbs.) |

LSM-5200

Compact (Panel-mount) Type Display Unit

- Panel-mount type (with dimensions conforming to DIN standards) allows easy system integration.
- Capable of calculating mean, maximum, minimum, and range (maximum minimum).
- Segment measurement (7 segments max.) or edge measurement (1 to 255 edges) can be selected.
- USB2.0, RS-232C and I/O-Analog interfaces are provided as standard.
- Arithmetical average or moving average can be selected.
- GO/±NG judgment function.



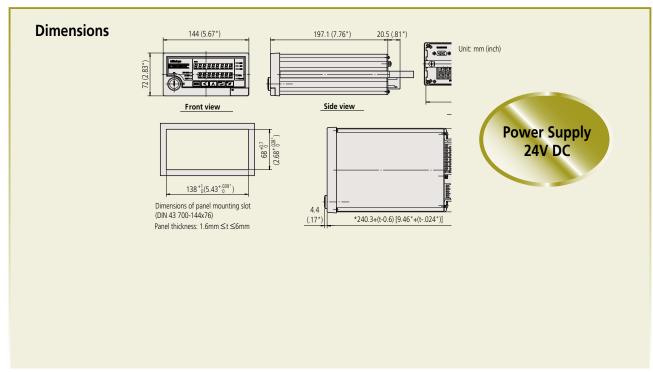

| Model | LSM-5200 | |
|-------------------------|--|--|
| Order No. | 544-047 | |
| Display | 9-digit LED (for measurement) & 8-digit LED (sub-display) | |
| Segment designation | Seg.1 to Seg.7 (Seg.1 - Seg.3 for transparent objects) | |
| Edge designation | 1 to 255 edges can be detected*1 | |
| Averaging times*2 | Arithmetical average: per 1 to 2048, moving average: per 32 to 2048 | |
| GO/±NG judgment | Nominal value ±tolerance setting, upper & lower limits setting | |
| Measurement mode | Waiting, single measurement, continuous measurement | |
| Statistical calculation | Available when connecting an external PC via the RS-232C or USB interfaces | |
| Power supply | +24V DC ±10%, 1A | |
| Data output | USB2.0, RS-232C and I/O-Analog interfaces | |
| Functions | (See page 30.) | |
| Operating temperature | 0°C - 45°C | |
| Operating humidity | 35 - 85% RH (with no condensation) | |
| Mass | 1.4kg (3.08lbs.) | |

^{*1:} With the **LSM-500S** the measuring range will be set to between 0.1 and 2mm if edge measurement is selected for 1 to 255 edges or if the automatic workpiece detecting function is on. *2: With the **LSM-500S** the number of scans will be limited to between 16 and 2048 for both arithmetical and moving averages if the ultra-fine wire measurement function is on.




DISPLAY UNIT

LSM-6200

Multi-function Type Display Unit

- With a dual-display design setup values can be continuously monitored. Also, two measurement value items can be displayed on the sub-display with the simultaneous measurement function.
- Either segment measurement (7 segments max.) or edge measurement (1 to 255 edges) can be selected.
- RS-232C and I/O-Analog interfaces are provided as standard.
- A statistical calculation function and abnormal data eliminating function are provided.



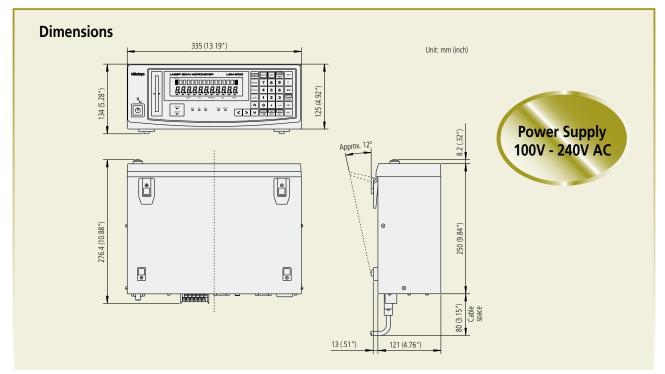

| Model | | LSM-6200 | | |
|---|-------------|---|---|--|
| Order No. | 100/110V AC | 544-071C | 544-072C | |
| (Order no. suffix | 120V AC | 544-071A | 544-072A | |
| denotes the AC power cord type | 220/230V AC | 544-071D | 544-072D | |
| equipped.) | 240V AC | 544-071E | 544-072E | |
| | 240V AC > | 544-071F | 544-072F | |
| Туре | | mm | inch/mm | |
| Display | | 16-digit fluorescent tube (for measurement) | & 11-digit fluorescent tube (sub-display) | |
| Segment design | nation | Seg.1 to Seg.7 (Seg.1 - Seg.3 | 3 for transparent objects) | |
| Edge designation | on | 1 to 255 edges can be detected*1 | | |
| Averaging time | ?S*2 | Arithmetical average: per 1 to 2048, moving average: per 32 to 2048 | | |
| GO/±NG judgment Nominal value ±tolerance sett | | Nominal value ±tolerance setting, upper & | lower limits setting, multi-limit setting | |
| Measurement r | mode | Waiting, single measurement, continuous measurement | | |
| Statistical calcu | lation | Maximum measurement (MAX), minimum measurement (| Maximum measurement (MAX), minimum measurement (MIN), mean, range (MAX-MIN), standard deviation (σ) | |
| Power supply | | 100 - 240V AC ±10% | 6, 50/60Hz, 40VA | |
| Data output (as | s standard) | Via RS-232C and I/O- | Analog interfaces | |
| Functions | | (See page 30.) | | |
| Operating temp | perature | 0°C - 45°C | | |
| Operating hum | nidity | 35 - 85% RH (with no condensation) | | |
| Mass | | 5kg (11 | 5kg (11lbs.) | |

For Australia

*1: With the **LSM-500S** the measuring range will be set to between 0.1 to 2mm if the edge measurement is selected for 1 to 255 edges or if the automatic workpiece detecting function is on.

*2: With the **LSM-500S** the number of scans will be limited to between 16 and 2048 for both the arithmetical and moving averages if the ultra-fine wire measurement function is on.

LSM-5200/6200/6900/9506 Functions

Measuring Setup Memory

The measuring setup can be registered as a program and saved (LSM-6200: 100 programs, LSM-6900: 10 programs, LSM-5200: 1 program). These programs can be recalled with a single operation.


Multiple Calibration Data Memory Function

This function allows storage of 10 types of calibration data. In this function mode, up to 10 sets of 10 programs are available in hand.

- 10 programs (a piece of calibration data) X 10 sets
- * LSM-6200 can only support this function.

Drill/Endmill (odd number flute) diameter measurement* *Only for LSM-6900

The diameter of drills or endmills that have an odd number of flutes can be measured by using the max/min value function.

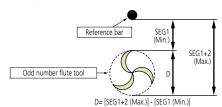

Automatic Workpiece Detection

This function automatically starts measurement when a workpiece advances into the specified measuring area.

Preset/Offset

Sets the currently displayed measurement value to zero or a specified numeric value. This is useful, for example, if a difference in the diameters of a reference gage and a workpiece is to be allowed for in calibration, or if a dimension of a workpiece that exceeds the measurement range of the LSM is to be measured.

Mastering

For continuous processing of high-precision workpieces, fine-adjusting the preset or offset value is called mastering. By specifying a mastering value the total correction will be (zero-set/offset value) + (±mastering value). If a positive mastering value is specified, the displayed value for a workpiece diameter measurement will be greater than the actual value: if a negative value is specified, the displayed value will be smaller than the actual value.

Sample Measurement

On a sample measurement the number of measurements will be defined (in the range of 2 to 999) in advance. From this sample measurement various calculation results (mean, maximum, minimum, and range) can be derived. These measurements can be used for runout measurements on a revolving workpiece and simplified cylindricity measurements.

Arithmetical Average/Moving Average


Arithmetical/moving average modes are provided to obtain the average of measurement values. On this type of LSM either of them can be specified before starting measurement. In the arithmetical average mode, the number of scans over which to take an averaging can be set at one of twelve steps between 1 (0.32ms) and 2048 (0.64sec). In the moving average mode the number of scans can be set at one of seven steps between 32 (0.01sec) and 2048 (0.64sec), and the measurement value will be updated every sixteen scans on and after the second measurement, irrespective of the specified number of scans for averaging. The latter mode is suitable for judging the trend in the diameter or width of an endless workpiece such as wire or tape from a measurement that requires a long period.

Measurement using Segment Specification


The following conventions are used to set up to the maximum of seven segments. However, if the transparent object measuring mode is set, no more than three segments can be set at one time.




 The outside diameter of a wire or cylindrical workpiece can be measured by using Seq.2.

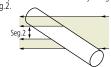


 The outside diameter of a large workpiece can be measured by using Seg.1 and Seg.5 in a dual-unit configuration. (only with LSM-6200).

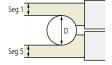

 Measurement of spacing of two parallel pins (pitch measurement)
 Pitch = ((Seg.2+Seg.4)/2)+Seg.3

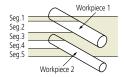

 The Runout of a revolving workpiece can be obtained by observing the variation in Seg.1 which is measured against a stationary reference pin.

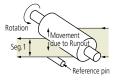


 If dimensions in both X and Y directions (min. distance of X/Y scanning section: 10mm) are measured through dual-unit measurement, use Seg.2 and Seg.6 (only with LSM-6200).



Automatic Measurement using Edges

The edges created by scanning a workpiece can be used to program an LSM. A maximum of 127 workpiece features, and 127 of the spaces between these features, can be used which involves a total of 255 edges. This is most useful for measuring such things as IC chip leads or connector pins that are approximately equally spaced. This method cannot be applied to transparent objects.

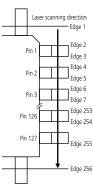

External trigger signal input*

*Not available for LSM-5200

By supplying a contact signal to the footswitch connector at the rear panel of the LSM-6200/6900/9506, the measurement can be triggered.

Abnormal Data Elimination

If a piece of data significantly exceeds the tolerance limit because the workpiece or measuring unit is contaminated by a water droplet, oil droplet, or dust, the piece of data will be automatically removed by this function.


Data Output Interval Setting

By setting an interval (between 1 and 999 seconds) to continuous measurement in advance, data output will take place at each specified period of time.


Statistical Calculation

With this function, multiple measurements are taken from the same kind of workpiece, statistical values are calculated from the measurement results and quality evaluation is executed for each lot.

> • Example of measuring a stepped cylinder using the statistical calculation function.

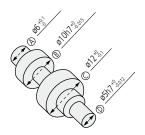

Measuring procedure: Measure the dimensions numbered
(A) to (D), perform tolerance judgment, and statistically process the resulting data for every ten samples defined as one lot.

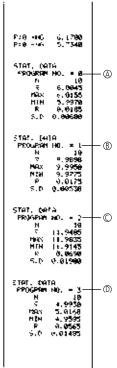

Data Output


Every model has a standard RS-232C interface unit, allowing data to be output to an external PC or printer.

The LSM-5200/6200 has the standard I/O-Analog output interface that allows the LSM to be connected to a sequencer, etc. The SPC (Digimatic Code) output interface is standard with the LSM-9506, allowing for easy construction of a quality control system. With the LSM-6200 there are additional means of data output, including SPC, BCD, and GP-IB output interfaces, which can be incorporated.

Multi-Limit Judgment*

*Not available for LSM-5200


In addition to +NG, GO, and -NG judgment criteria limit values from Limit 1 to Limit 6 can also be set. If an optional 2nd I/O-Analog interface unit (02AGC880) is used with the LSM-6200/6900/9506, seven-step judgment signals can be output to external devices to support GO/NG judgment.

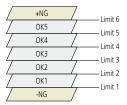

*Not available for LSM-5200

Simultaneous (Dual-program) Measurement*

It is possible to measure two items simultaneously with one Laser Scan Micrometer unit, and to output the data. This function can be used to simultaneously measure the outside diameter and runout of a bar that is rotating, or to measure the outside diameters of two cylinders or wires at the same time.

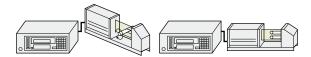

Restrictions Associated with Particular Combinations of Functions

| | Edge spe | cification | Transpar- | Ultra-fine | A | A1 | C I . | | 6 |
|-------------------------------------|----------------------------|-------------------------------|--------------------------------|---------------------------|-------------------------------------|---------------------------------|----------------------------|-------------------|--------------------------|
| Combinations of Functions | Manual measure- ment | Automatic measure- ment | ent object measure- ment | wire measure- ment* | Automatic workpiece detection | Abnormal data elimination | Sample measure- ment | Moving average | Group judg- ment** |
| Edge Manual measurement | | _ | _ | _ | • | • | • | • | • |
| specification Automatic measurement | _ | | _ | _ | • | _ | _ | _ | _ |
| Transparent object measurement | _ | _ | | • | • | • | • | • | • |
| Ultra-fine wire measurement* | _ | _ | • | | _ | • | • | • | • |
| Automatic workpiece detection | • | • | • | _ | | • | • | _ | • |
| Abnormal data elimination | • | _ | • | • | • | | • | • | • |
| Sample measurement | • | _ | • | • | • | • | | • | • |
| Moving average | • | _ | • | • | _ | • | • | | _ |
| Group judgment** | • | _ | • | • | • | • | • | _ | |

^{•:} Permitted combination, —: Combination that is not permitted

^{*}Function that is not provided for LSM-9506 **Function that is not provided for LSM-5200

DISPLAY UNIT


LSM-5200/6200/6900/9506 Data I/O Specifications


RS-232C Interface

Allows the LSM to communicate with external devices via RS-232C (conforming to the EIA standard) serial signals. Depending on the basic setup this interface can be used as a printer port.

Pin assignment of the connector

Matching plug: D-sub 9pin (female)

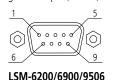

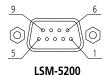

Communication specifications

| Definition of device | | DTE definition on the side of LSM | |
|--------------------------|-------------------|-----------------------------------|--|
| Data transmission method | | All-duplex transmission | |
| Syncronizing method | | Start-stop system | |
| Data transmission | 6200 | 4800, 9600, 19200, 38400bps | |
| speed | 5200, 6900 | 1200, 2400, 4800, 9600, 19200bps | |
| | Transmission code | ASCII | |
| 5. | Data length | 7 or 8 bits | |
| Data arrangement | Start bit | 1 bit | |
| arrangement | Parity check | Non, odd or even | |
| | Delimiter | CR+LF, CR, LF | |


Commands

Various external commands, including those for setting measuring conditions, setting the measurement mode, starting measurement, and requesting statistical calculation, are supported. This allows the user to control the LSM from an external unit (e.g. PC) for customized measurements.


Connections

(1) Connecting the RS-232C interface to a device specified as a terminal (DTE)


Example 1: Flow control method (handshake method controlled by CTS, DSR, DTR, and RTS signals)

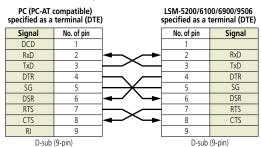

Example 2: Flow control method (handshake method controlled by CTS, DSR, DTR, and RTS signals)

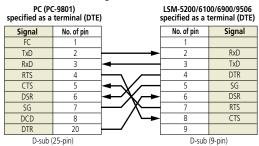


Example 3: 3-Wire method (teletype protocol using TxD, RxD and SG)

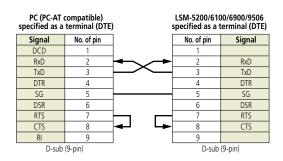

(2) Connecting the RS-232C interface to a device specified as a modem (DCE)

Example 1: Flow control method (handshake method controlled by CTS, DSR, DTR, and RTS signals)

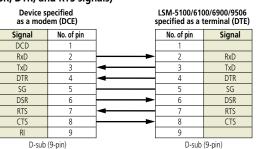




*Not available for LSM-9506

I/O-Analog Interface*

Used to communicate with a PC, programmable controller, or relay circuitry by means of sequential signals. It is also capable of producing an analog voltage output that may be used for feedback control and/or continuous recording of workpiece dimension deviation.

External view of the connector

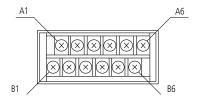


Pin assignment (of LSM-6200/6900)

| | _ | | |
|----------|--------|---|-----|
| Terminal | Signal | Function | I/O |
| A1 | FG | Frame ground (Used for connecting the shield conductor of I/O signal cables) | _ |
| A2 | STS | Output of measurement condition (Goes high in the event of "Err-0") | OUT |
| A3 | GO | GO/NG judgment result output (GO) (Can be changed to strobe signal (STB) or measurement in-progress signal (ACK)output by the basic setup) | OUT |
| A4 | +NG | GO/NG judgment result output (+NG) | OUT |
| A5 | -NG | GO/NG judgment result output (-NG) | OUT |
| A6 | GND | Digital ground (Common ground terminal of both output (A2 thru A5) and input (B4 thru B6) | _ |
| B1 | FG | Frame ground (Used for connecting the shield conductor of I/O signal cables) | |
| B2 | ALG | Analog voltage output | OUT |
| B3 | 0V | 0V reference for analog voltage output | OUT |
| B4 | OFFS | Offset input (Can be changed to (HOLD) by the basic setup) | IN |
| B5 | RUN | Input of trigger command for single-run measurement (Can be changed to a trigger for continuous-run measurement (with term specification)) | IN |
| B6 | RES | Input of CLEAR command | IN |

Note: The pin assignment for the LSM-5100 may differ.

Input/output equivalent circuit


(1) Input circuit

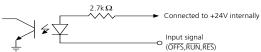

- •Low-level signal to be between 0 and 1V. Generally drive this circuit with an open collector-type transistor.
- Maximum current drawn from the input signal terminal is 12mA.

(2) Output circuit

1. Control signal output

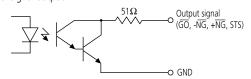

• Maximum rating of the output transistor is 30V, 50mA.

2. Analog signal output



•The output voltage range is ±5V.

• The accuracy of the analog voltage output is 0.2% of full-scale range.

•This analog output should be connected to a device that has an input impedance of $1M\Omega$ or greater. If the input impedance is lower than this value, the output accuracy will be reduced due to the internal resistance of 560Ω .

Remote Interlock Connector

The Remote Interlock Connector is provided as a means of turning the laser beam on and off from a remote location. Since the supplied short-circuit pin is usually inserted in this terminal, the circuit is short-circuited. Insert an optional switched plug to allow external control of the LSM laser.

Laser emission ON: Short-circuit pin inserted Laser emission OFF: Short-circuit pin removed

REMOTE INTERLOCK

No.214938

Scanning Signal Connector

The Scanning Signal Connector is provided for observing the output signal waveform from the reception chip in the measuring unit. Typically, this connector is used to align the emission unit and reception unit after they have been removed from the original base and then mounted on a different base.

No.02AGC401

SCAN SIG-2



Optional Accessories

LSM Control/Data Processing Software

LSMPAK

Available in the near future



Outline

This software can import measurement data from multiple LSM-5200 Display Units to a personal computer, allowing a variety of measuring systems to be constructed.

Features

- Capable of processing a maximum of 10 channels of measured-point data (USB-HUB connection).
- Capable of composite calculation between Measuring Units (multiple channels), statistical calculation, and calculation results output as a file.


Other Functions

• Rich choice of functions (e.g. counter, graphs, calculation

Operating Environment


- Connection interface: USB2.0
 PC: DOS/V compatible machine
 CPU: 2GHz or more (recommended)
- OS/software: WindowsXP, Excel2000XP Japanese version
- Memory: 256MB or more (recommended)
- Applicable display unit: LSM-5200


SystemDiagram Example of concurrent multi-point measurement of printer rollers

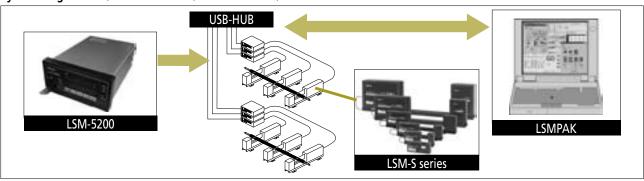


BCD Interface Unit (02AGC910)


•Outputs a 7-digit BCD and a positive or negative sign.

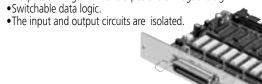

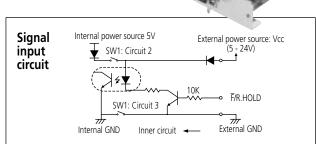

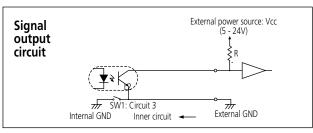



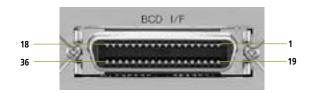

Pin assignment of BCD Interface Unit

| Pin No. | Signal name | Pin No. | Signal name |
|---------|---------------------|---------|---------------------|
| 1 | 1 x 10° | 15 | 4 x 10 ³ |
| 2 | 2 x 10° | 16 | 8 x 10 ³ |
| 3 | 4 x 10° | 17 | 1 x 10 ⁴ |
| 4 | 8 x 10° | 18 | 2 x 10 ⁴ |
| 5 | 1 x 10 ¹ | 19 | 4 x 10 ⁴ |
| 6 | 2 x 10 ¹ | 20 | 8 x 10 ⁴ |
| 7 | 4 x 10 ¹ | 21 | 1 x 10 ⁵ |
| 8 | 8 x 10 ¹ | 22 | 2 x 10 ⁵ |
| 9 | 1 x 10 ² | 23 | 4 x 10 ⁵ |
| 10 | 2 x 10 ² | 24 | 8 x 10 ⁵ |
| 11 | 4 x 10 ² | 25 | 1 x 10 ⁶ |
| 12 | 8 x 10 ² | 26 | 2 x 10 ⁶ |
| 13 | 1 x 10 ³ | 27 | 4 x 10 ⁶ |
| 14 | 2 x 10 ³ | 28 | 8 x 10 ⁶ |

| Annlicable | connector. | 57-40360-D | (Standard | accessory) |
|------------|-------------|------------|------------|------------|
| Applicable | COITICCTOI. | 37 40300 D | (Staridard | accessory/ |


| Pin No. | Signal name |
|---------|-----------------------------|
| 29 | Err.0 (Segment error) |
| 30 | HOLD (input) |
| 31 | F/R |
| 32 | STB (Strobe output) |
| 33 | EXT.Vcc (Ext. power) |
| 34 | +POLE (Polarity) |
| 35 | GND (Signal GND) |
| 36 | FG (Frame GND) |


*Not available for LSM-6900


Digimatic Code-out Unit (02AGC840)

- Provides two channels of SPC (Digimatic) output.Outputs the following during simultaneous measurement: From OUTPUT1: Measured values by PRG.0 through PRG.4. From OUTPUT2: Measured values by PRG.5 through PRG.9
- •The output cable (936937) is optional.



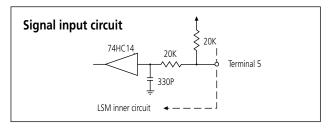

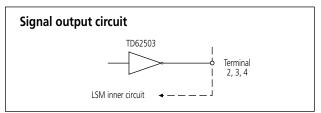

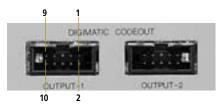


Pin assignment of Digimatic Code-out Unit


| _ | | _ | |
|------------|-------------|-----|-------------------------|
| Pin No. | Signal name | 1/0 | Function |
| 1 | GND | _ | Signal GND |
| 2 | DATA | OUT | Data out |
| 3 | CK | OUT | Data transmission clock |
| 4 | RD | OUT | Data read request |
| 5 | REQ | IN | Data output request |
| 6, 7, 8, 9 | I.C | _ | Spare |
| 10 | F.G | _ | Frame GND |

Dual-type Add-on Unit (02AGP150)*


- Enables a second measuring unit to be connected to the display unit (this is possible only if the two measuring units are the same model).

 • Depending on the layout of the two measuring units, large-diameter
- measurement, XY measurement, and parallel measurement are possible.
- •The sub-display of the LSM-6200 allows simultaneous measurement and display with two measuring units.

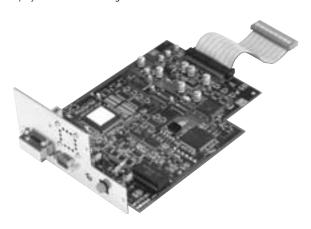

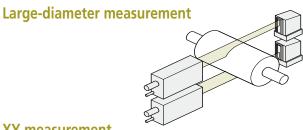


XY measurement

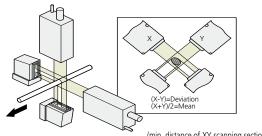

(min. distance of XY scanning section: 10mm)

Parallel measurement

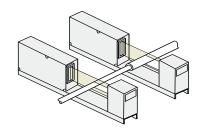



Optional Accessories


2nd I/O-Analog Interface Unit (02AGC880)

Provides I/O capability and analog voltage output for GO/±NG judgment.
 Provides two sets of GO/NG judgment result outputs. Fully compatible with simultaneous measurement, since



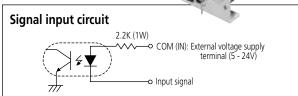

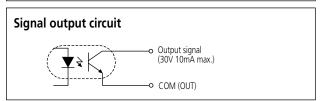

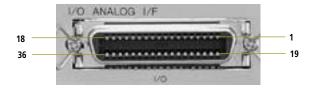

Pin assignment of 2nd I/O-Analog Interface Unit

| Pin No. | Signal name | 1/0 |
|---------|-------------|------------------|
| 1 | +5V | (Internal power) |
| 2 | COM (IN) | (IN) |
| 3 | PROG.0/b0 | IN |
| 4 | PROG.2/b2 | IN |
| 5 | PROG.4/PRG | IN |
| 6 | SHIFT | IN |
| 7 | RUN | IN |
| 8 | Ā•(-NG) | OUT |
| 9 | I.C | (OUT) |
| 10 | I.C | (OUT) |
| 11 | B•(-NG) | OUT |
| 12 | B•(+NG) | OUT |
| 13 | I.C | (OUT) |
| 14 | Ā•(+NG) | OUT |
| 15 | Ā•(GO) | OUT |
| 16 | ERR.0 | OUT |
| 17 | COM (OUT) | (OUT) |
| 18 | CNT | OUT |
| 19 | GND | (Internal power) |
| 20 | COM (IN) | (IN) |
| 21 | PROG.1/b1 | IN |
| 22 | PROG.3/b3 | IN |
| 23 | IC | (OUT) |
| 24 | PRINT | IN |
| 25 | RESET | IN |
| 26 | Ā•(GO) | OUT |
| 27 | I.C | (OUT) |
| 28 | I.C | (OUT) |
| 29 | B•(GO) | OUT |
| 30 | I.C | OUT |
| 31 | I.C | (OUT) |
| 32 | Ā•(-NG) | OUT |
| 33 | ĀCK | OUT |
| 34 | STB | OUT |
| 35 | COM (OUT) | (OUT) |
| 36 | FG | _ |

With a combined use of b0, b2, PRG, b1 and b3 maximum 100 patterns of program can be used.





System Extension Devices

Extension Cable for Concurrent Installation of BCD and Second I/O-Analog Interface

No.02AGE060

- •The use of this cable enables concurrent installation of BCD (No.**02AGC910**) and second I/O-Analog interface (No.**02AGC880**) in LSM-6200/6900.
- *Restrictions
 If this cable is used, the dual extension unit (No.**02AGP150**) is not available.

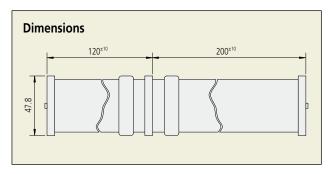

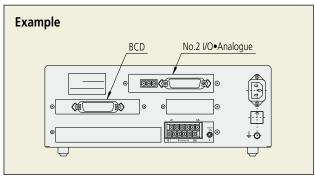

Thermal Printer

- •This printer can be connected to any LSM-5100, -6200, -6900 or -9506 model.
- Both measurement values and statistical calculation results can be printed (only with LSM-6200/6900/9506).
- Connection cable is supplied.



| Order No. | 02AGD600A (w/100V AC adapter) 02AGD600B (w/120V AC adapter) 02AGD600C (w/130V AC adapter) |
|-------------------------------|--|
| Туре | Thermal serial-dot printer |
| Digits per line | 40 |
| Character format | 9x8 dot matrix |
| Data input | Via RS-232C interface |
| Printer life | 500,000 lines |
| Operational temperature range | 0°C to 50°C |
| Power supply | Via AC adapter (100V AC, 50/60Hz) |
| Standard accessories | Printer paper (1 roll), AC adpter |
| Consumable item | Printer paper set (10-roll, 223663) |

Footswitch (937179T)*

•Connecting the Footswitch to the LSM-6100/6900/9506 enables the user to initiate a single measurement externally.






Glossary

1. Linearity

This is a specified value that defines the maximum error* that may be indicated by the LSM after calibration**, anywhere within its measuring range, when measuring a workpiece in the center of the measuring region. Note that the linearity specification does not include the calibration error specification of the calibration gages themselves. This error must be added separately.

- * The difference between the result of measuring a dimension and the true value of the dimension measured.
- ** Optional calibration gages are available for each model of LSM to provide appropriate high and low calibration points (HiCAL and LoCAL on the diagram).

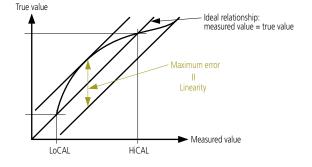


2. Repeatability

Means, in the center of a measuring region, the dispersion $(\pm 2\sigma)$ of measurement values as the result of continuous measurement for 2 minutes with the number of scans for averaging set at 512 times (1024 times for LSM-902/6900) without moving a workpiece of the maximum measurement diameter on each measuring unit.


3. Position error

Means an error with reference to the measurement value at the center of the measuring region if a workpiece is displaced in the measuring region. A position error consists of an up-down error and a parallel error as shown in the following figure. This error separately affects measurement accuracy.

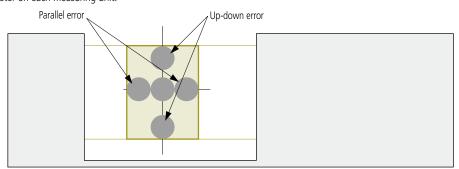


4. Measuring region

The LSM provides numeric values for which the accuracy (linearity + position error) is guaranteed only if a workpiece is located within the prescribed space domain. This domain is called the measuring region. A measuring region is determined by [laser beam scanning direction range] x [optical axis direction range]. To perform measurement with a minimum of error, it is necessary to measure a workpiece at the center of this measuring region. As an example in the figure right, workpieces 1, 2, 5, and 6 cannot be measured because these are outside the measuring region. For workpieces 3 and 4, a position error is added to a linearity error.

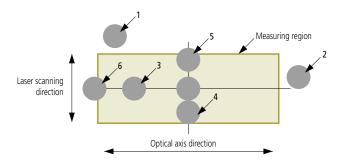

5. Beam diameter and width

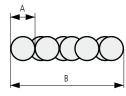

| | LSM-902/6900 | LSM-500S | LSM-501S | LSM-503S | LSM-506S | LSM-9506 | LSM-512S | LSM-516S |
|-----------------|--------------|----------|----------|----------|----------|----------|----------|----------|
| Beam diameter A | 200µm | 80µm | 120µm | 240µm | 600µm | 600µm | 1200µm | 1200µm |
| Beam diameter B | 300µm | 120µm | 170µm | 340µm | 800µm | 800µm | 1600µm | 1600µm |



PRECAUTIONS

Observe the following precautions

Compatibility

Your Laser Scan Micrometer has been adjusted together with the ID Unit, which is supplied with the measuring unit. The ID Unit, which has the same code number and the same serial number as the measuring unit, must be installed in the display unit. This means that if the ID Unit is replaced the measuring unit can be connected to another corresponding display unit.

The workpiece and measuring conditions

Depending on whether the laser is visible or invisible, the workpiece shape, and the surface roughness, measurement errors may result. If this is the case, perform calibration with a master workpiece which has dimensions, shape, and surface roughness similar to the actual workpiece to be measured. If measurement values show a large degree of dispersion due to the measuring conditions, increase the number of scans for averaging to improve the measurement accuracy.

Electrical interference

To avoid operational errors, do not route the signal cable and relay cable of the Laser Scan Micrometer alongside a highvoltage line or other cable capable of inducing noise current in nearby conductors. Ground all appropriate units and cable

Connection to a computer

If the Laser Scan Micrometer is to be connected to an external personal computer via the RS-232C interface, ensure that the cable connections conform to the specification.

Laser safety

appropriate.

Mitutoyo Laser Scan Micrometers use a low-power visible laser for measurement. The laser is a CLASS 2 IEC 825-1 device and a CLASS II 21 CDRH device. Warning and explanation labels, as shown right, are attached to the Laser Scan Micrometers as is






Re-assembly after removal from the base


Observe the following limits when re-assembling the emission unit and reception unit to minimize measurement errors due to misalignment of the laser's optical axis with the reception unit.

(1) Alignment within the horizontal plane

a. Parallel deviation between reference lines C and D: X (in the transverse direction)

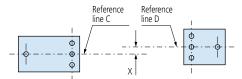


b. Angle between reference lines C and D: θx (angle)

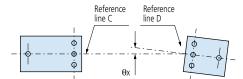


(2) Alignment within the vertical plane

c. Parallel deviation between reference planes A and B: Y (in height)

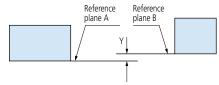

d. Angle between reference planes A and B: Θ y (angle)

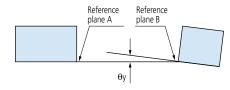


(3) Allowable limits of optical axis misalignment

| Model | Distance between Emission Unit and Reception Unit | X and Y | θ x and θ y |
|-------------|---|---------------------|---------------------------|
| LSM-501S | 68mm (2.68") or less | within 0.5mm (.02") | within 0.4° (7 mrad) |
| F21A1-20.12 | 100mm (3.94") or less | within 0.5mm (.02") | within 0.3° (5.2 mrad) |
| LSM-503S | 130mm (5.12") or less | within 1mm (.04") | within 0.4° (7 mrad) |
| L3IVI-3U33 | 350mm (13.78") or less | within 1mm (.04") | within 0.16° (2.8 mrad) |
| LSM-506S | 273mm (10.75") or less | within 1mm (.04") | within 0.2° (3.5 mrad) |
| F2IAI-2002 | 700mm (27.56") or less | within 1mm (.04") | within 0.08° (1.4 mrad) |
| LSM-512S | 321mm (12.64") or less | within 1mm (.04") | within 0.18° (3.6 mrad) |
| LSIVI-5125 | 700mm (27.56") or less | within 1mm (.04") | within 0.08° (1.4 mrad) |
| LSM-516S | 800mm (31.50") or less | within 1mm (.04") | within 0.09° (1.6 mrad) |




QUICKTOOL

• QUICKTOOL is free software that makes the key operation of LSM-6200 setting simple and easy. Please contact your Mitutoyo office.

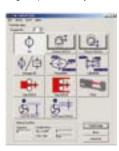



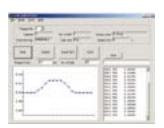

Export permission by the Japanese government may be required for exporting our products according to the Foreign Exchange and Foreign Trade Law. Please consult our sales office near you before you export our products or you offer technical information to a nonresident.

Coordinate Measuring Machines

Vision Measuring Systems

Form Measurement

Optical Measuring

ensor Systems

Test Equipment and Seismometers

Digital Scale and DRO Systems

Small Tool Instruments and Data Management

Mitutoyo Corporation

20-1, Sakado 1-Chome, Takatsu-ku, Kawasaki-shi, Kanagawa 213-8533, Japan T +81 (0) 44 813-8230 F +81 (0) 44 813-8231 http://www.mitutoyo.co.jp



Note: All information regarding our products, and in particular the illustrations, drawings, dimensional and performance data contained in this pamphlet, as well as other technical data are to be regarded as approximate average values. We therefore reserve the right to make changes to the corresponding designs, dimensions and weights. The stated standards, similar technical regulations, descriptions and illustrations of the products were valid at the time of printing. Only quotations submitted by ourselves may be regarded as definitive.